Q-336R1

SVE BULLETIN

SPECIAL VEHICLE ENGINEERING – BODY BUILDERS ADVISORY SERVICE

E-Mail via Website: www.FordBBAS.com (click "Contact Us")

Toll-free: (877) 840-4338

QVM BULLETIN: Q-336R1 DATE: 7 / JULY / 2021

2021MYF59 COLUMN MOUNTED SHIFTER

REVISION	UPDATE	REVISION DATE
Q-336R1	UPDATED TO CLARIFY MODIFICATION REQUIREMENTS	7/ JULY/ 2021
Q-336	INITIAL RELEASE	12 / MAY / 2021

MODEL(S) AFFECTED:

2021 F-59 Commercial Chassis

ISSUE / DESCRIPTION:

For the 2021 Model Year (MY), if a dash or remote shifter is to be installed as a vehicle upfit then the following parts must be ordered using a Vehicle Special Order (VSO) inquiry: **FI3B-3F832-BLW**

For the 2022MY, these parts will be available as a regular production feature when **Interior Trim Pack 1** is selected (reference Vehicle Order Guide for Option Code). This will include the appropriate shroud when an upfitted dash mounted shifter installed.

If Dash-Mounted Shifter and Dash Mounted Ignition Switch are **NOT** required for the vehicle vocational upfit, then W718409-S300 Plug must be installed.

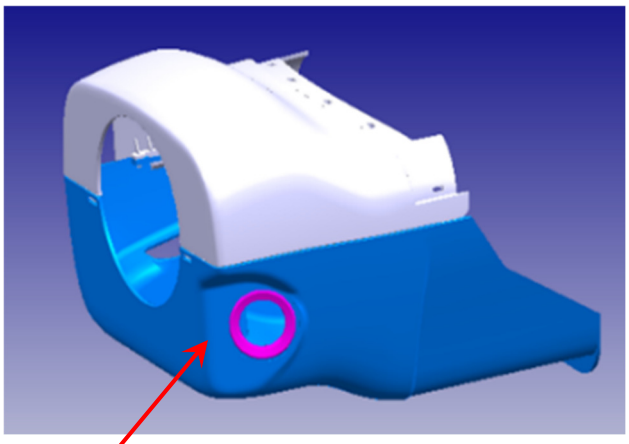

Remove the ring/Bezel from the shroud and install plug W718409-S300

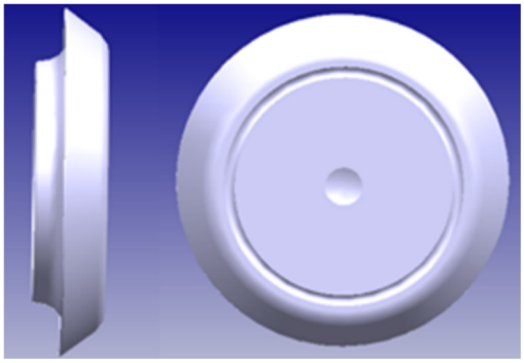

W718409-S300 Plug

If Dash-Mounted Shifter and the Ignition Switch are to be retained in the factory position, then the W718409-S300 plug is not needed.

Refer to the Body Builder Layout Book for additional guidelines and recommendations. If you have any questions, please contact the Ford Body Builders Advisory Service as shown in the header of this bulletin.